


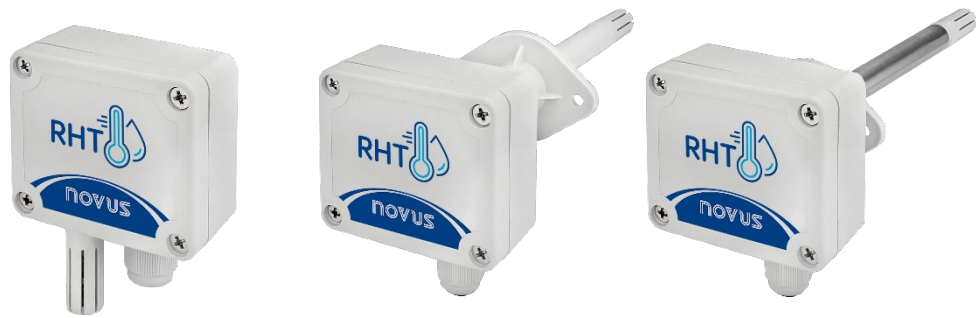

RHT-WM and RHT-DM Transmitter

USER GUIDE – V3.0x E

novus
We Measure, We Control, We Record



1	SAFETY ALERTS.....	3
2	INTRODUCTION	4
3	INSTALLATION	4
3.1	RHT-DM: MECHANICAL INSTALLATION	4
3.1.1	RHT-DM MODEL: PLASTIC PROBE	5
3.1.2	RHT-DM MODEL: METAL PROBE	5
3.2	RHT-WM: MECHANICAL INSTALLATION	6
3.3	TYPES OF TIPS	6
3.3.1	INSTALLATION	6
3.4	ELECTRICAL INSTALLATION.....	7
3.4.1	INSTALLATION RECOMMENDATIONS.....	7
3.5	SENSOR MAINTENANCE	7
3.5.1	PRECAUTIONS WHEN HANDLING SENSORS	7
3.5.2	SENSOR REPLACEMENT	8
4	CONFIGURATION	9
5	SIGNOW SOFTWARE AND APP	10
5.1	SIGNOW SOFTWARE	10
5.1.1	CONFIGURATION SECTION	10
5.1.2	DIAGNOSTIC SECTION	12
5.2	SIGNOW APP.....	14
6	SPECIFICATIONS.....	15
6.1	ACCURACY OF MEASUREMENTS AND OPERATING LIMITS OF SENSORS.....	16
6.2	FACTORY SETTINGS	16
6.3	CERTIFICATIONS.....	16
7	WARRANTY	17

1 SAFETY ALERTS

The following symbols are used on the equipment and throughout this manual to draw the user's attention to important information related to the safety and use of the equipment.

		
CAUTION Read the manual completely before installing and operating the device.	CAUTION OR HAZARD Risk of electric shock.	ATTENTION Material sensitive to static charge. Be sure to take proper precautions before handling it.

All safety recommendations appearing in this manual must be followed to ensure personal safety and prevent damage to the instrument or system. If the instrument is used in a manner other than that specified in this manual, the device safety protections may not be effective.

2 INTRODUCTION

The **RHT-WM** and **RHT-DM** transmitters have highly accurate and stable sensors for measuring relative humidity and temperature. The measured values are converted into 4 to 20 mA output signals linearly related to their readings.

Since they are microprocessor-based devices, they can be configured via **SigNow** software or app. Humidity measurement and transmission can be configured between **Relative Humidity** and **Dew Point**.

3 INSTALLATION

3.1 RHT-DM: MECHANICAL INSTALLATION

The **RHT-DM** (Duct Mount) model has the following dimensions (in millimeters):

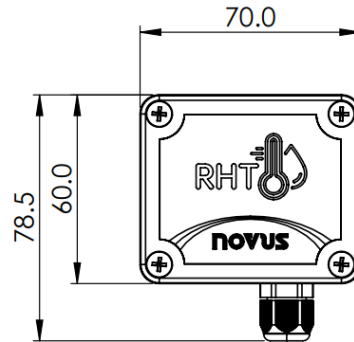


Figure 1

It is fixed with a flange. First, the flange is fixed to the duct wall. The probe is then inserted into the center hole of the flange and then attached. The figure below shows the dimensions and drilling of the flange (in millimeters):

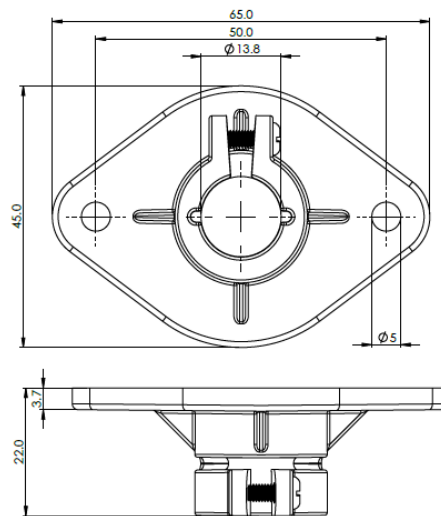


Figure 2

The probe of this model comes in lengths of 150 mm or 250 mm and is either metal or plastic.

3.1.1 RHT-DM MODEL: PLASTIC PROBE

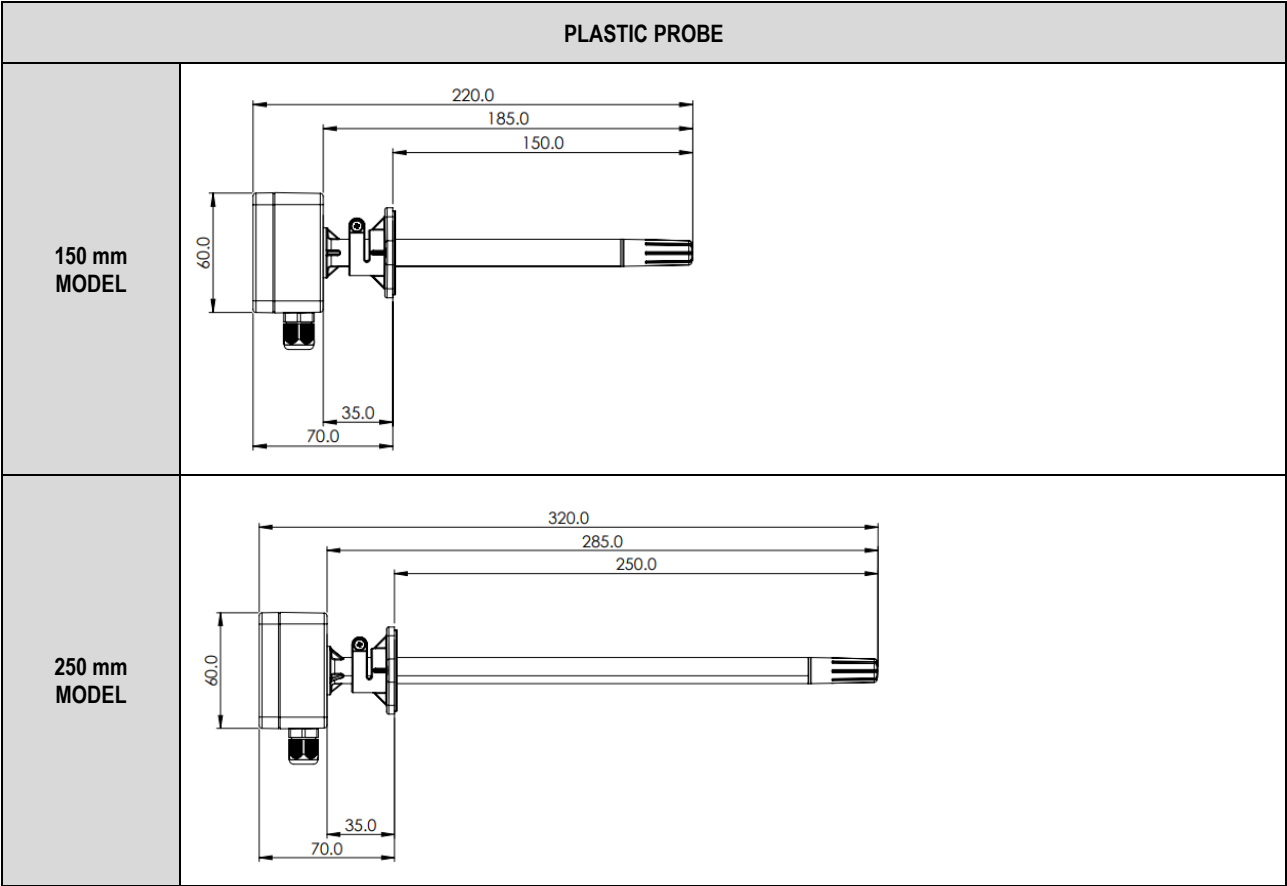


Figure 3

3.1.2 RHT-DM MODEL: METAL PROBE

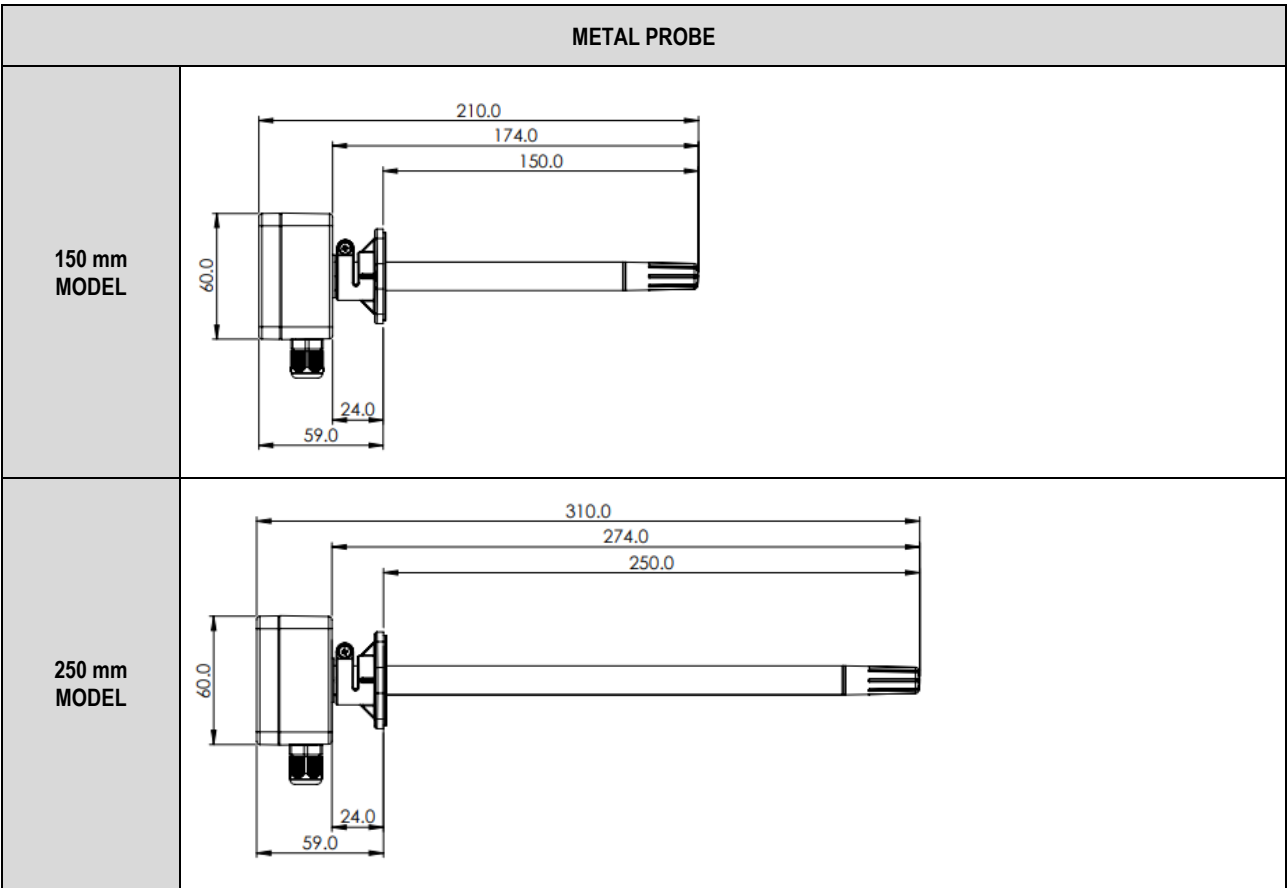


Figure 4

3.2 RHT-WM: MECHANICAL INSTALLATION

The **RHT-WM** (Wall Mount) model is designed to be fixed to a wall. By removing its cover, you can access the two fixing holes of the base and the wiring connector, as shown below:

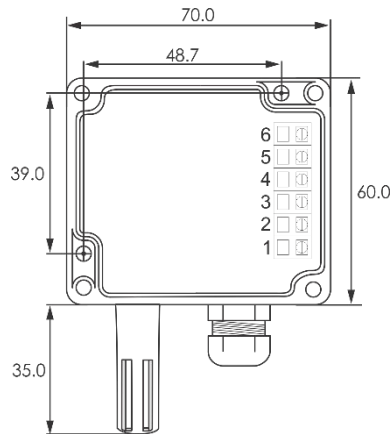


Figure 5

To ensure the specified accuracy and degree of protection, the transmitter should be fixed with the sensor capsule facing downwards.

3.3 TYPES OF TIPS

NOVUS offers 3 types of tips, which can be purchased from authorized distributors:

- **Polyamide tip** (see figure beside): It has side openings that allow the sensor to be more exposed to the environment in which it was installed, having a shorter response time. This tip comes with **RHT**.
Order code: 8803900120



- **High Density Polyethylene (PE) tip** (see figure beside): Made of a porous material, it protects the sensor from dust and other solid particles. However, by reducing contact with the environment to be measured, the response time of this tip tends to be longer than that of the Polyamide tip (see **Note 1**).
Order code: 8803900110



- **Sintered Bronze tip** (see figure beside): Made of a porous material, it protects the sensor from dust and other solid particles. It has more mechanical robustness than the Polyethylene tip. However, by reducing contact with the environment to be measured, the response time of this tip tends to be longer (see **Note 1**).
Order code: 8803900100




Note 1: This increase in response time depends, among other things, on the speed of the air (or gas) where the sensor is inserted.

3.3.1 INSTALLATION

1. Remove the tip from **RHT** by slowly unscrewing it. When removing it, take care that only the tip rotates in the equipment.
2. The sensor circuit board will be exposed. It must not be touched!
3. Screw in the new tip carefully. It is not necessary to force the thread at the end.

3.4 ELECTRICAL INSTALLATION

The figures below show the necessary electrical connections:

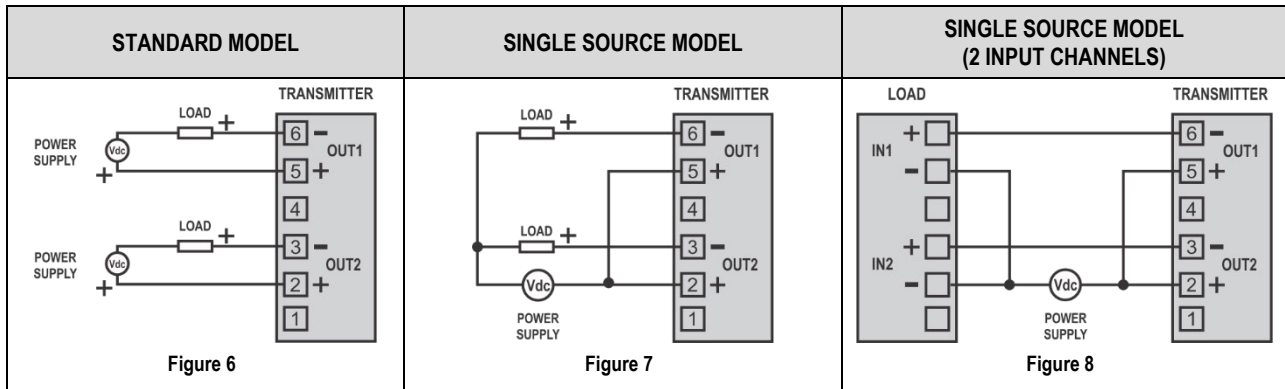

The OUT1 loop must always be powered!

In the figures above, the **LOAD** represents the instrument measuring the output signal (indicator, controller, data logger, etc.). The electrical wires from the connections reach inside the transmitter, passing through the cable gland attached to the transmitter housing.

3.4.1 INSTALLATION RECOMMENDATIONS


- Small electrical signal conductors should run through the system plant separately from actuation conductors or conductors with high current or voltage values. If possible, in grounded conduits.
- The power supply for the electronic instruments must come from a proper instrumentation network.
- In control applications, it is essential to consider what can happen when any part of the system fails.
- It is recommended to use RC FILTERS (noise suppressors) at contactor coils, solenoids, etc.

3.5 SENSOR MAINTENANCE

3.5.1 PRECAUTIONS WHEN HANDLING SENSORS

If exposed to contaminant vapors or extreme humidity and temperature conditions for prolonged periods, the calibration of the humidity sensor may be affected. To accelerate the calibration reset, proceed as described below:

- Unscrew and remove the transmitter's protective tip.
- Carefully remove the sensor from the transmitter.
- Perform the **baking (thermal drying)** process:
 - **Temperature:** 100 to 105 °C (212 to 221 °F)
 - **Relative humidity:** < 5 % RH
 - **Duration:** 10 hours
- Perform the **rehydration** process:
 - **Temperature:** 20 to 30 °C (68 to 86 °F)
 - **Relative humidity:** ~ 75 % RH
 - **Duration:** 12 hours
- Carefully reinstall the sensor in the transmitter.
- Insert and screw the transmitter's protective tip back on.

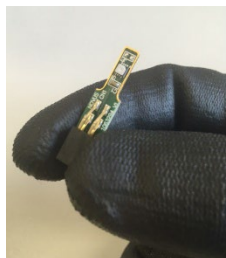

The sensor should only be held by the connector area and its proximities. Avoid handling the sensor by the thinner end. Do not touch the sensor.

For this procedure, it is recommended to wear clean anti-static gloves.

3.5.2 SENSOR REPLACEMENT

In case of damage, it may be necessary to replace the humidity and temperature sensor. To perform this procedure, follow the steps below:




- **Step 1:** Disconnect the equipment from the power supply. Locate the protective tip of the sensor.


This example displays the replacement of the sensor of an **RHT-DM** transmitter. In it, the sensor is located at the end of the probe.




- **Step 2:** Remove the tip by turning it counterclockwise.

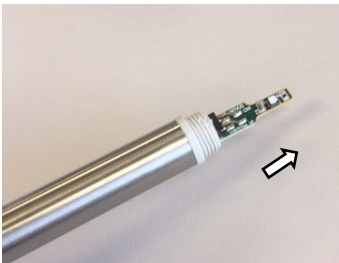

- **Step 3:** Without the tip, the sensor will be exposed. It should be removed by pulling it forward to disconnect it.

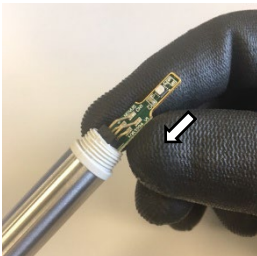

- **Step 4:** Connect the new sensor to the probe tip connector. Use clean anti-static gloves or other measures to prevent static discharge. Avoid unnecessary handling.

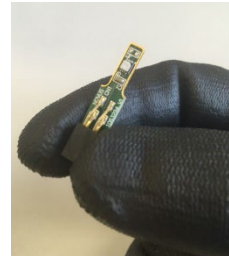

The sensor should only be held by the connector area and its proximities. Avoid handling the sensor by the thinner end. Do not touch the sensor.

For this procedure, it is recommended to wear clean anti-static gloves.



- **Step 5:** Replace the protective tip and slowly turn it clockwise to secure it to the equipment.

4 CONFIGURATION

For the model already configured with the proper ranges, no intervention is required. The installation can be performed immediately.

When you need to change the configuration, you should use **SigNow** software or app (see [SIGNOW SOFTWARE AND APP](#)).

To configure the equipment through the software, you must connect the **TxConfig-USB** Configuration Interface (purchased from the manufacturer or its authorized representatives) to the USB port of the computer used and run the software, as shown in the figure below:

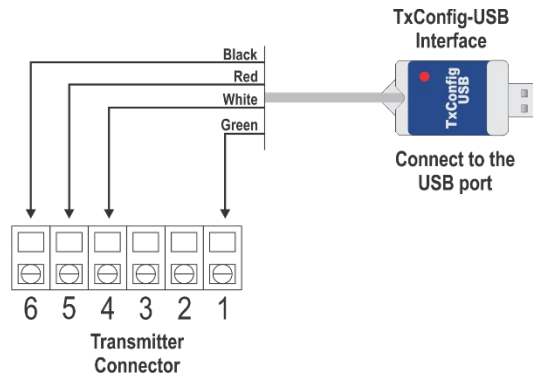


Figure 9

To configure the device via **SigNow** app, you need to use an OTG cable with the **TxConfig-USB** Configuration Interface. Smartphones with On the Go (OTG) technology can be directly connected to the device via the USB port. Using the **TxConfig-USB** Configuration Interface, it is possible to recognize and configure **RHT** by running **SigNow** app.

To do this, as shown in the figure below, you need to observe how to connect the OTG cable to the equipment:

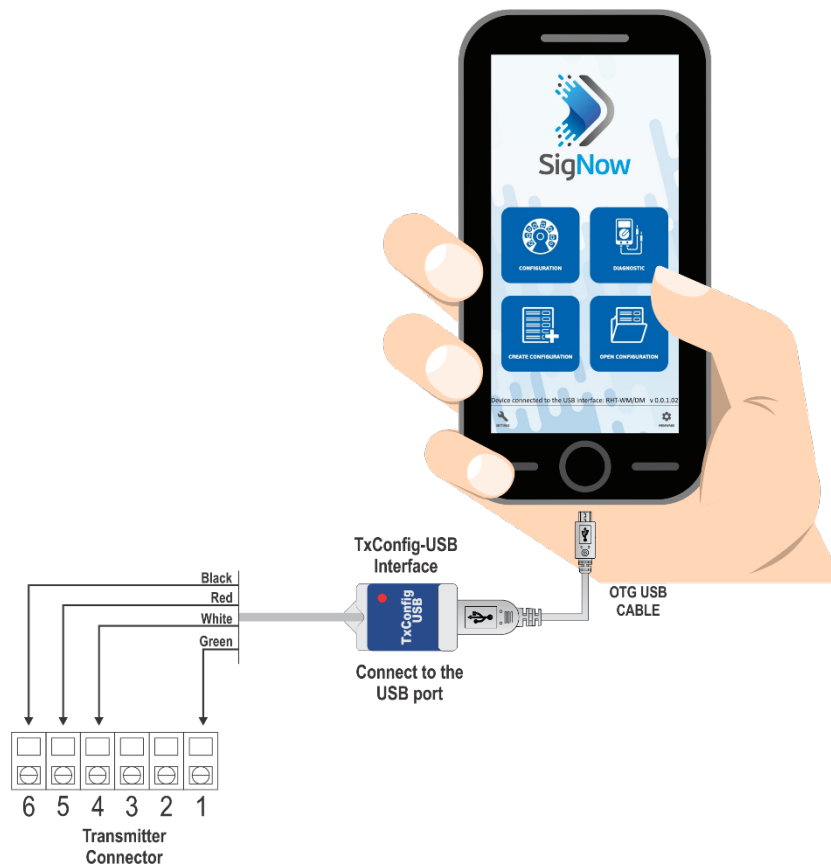


Figure 10



If you position the cable end incorrectly, it is possible that the device will not be recognized by the application.

On **NOVUS** website, you can download the configuration software for free (see [SIGNOW SOFTWARE](#)).

SigNow app can be downloaded for free from *Google Play Store* (see [SIGNOW APP](#)).

5 SIGNOW SOFTWARE AND APP

The **SigNow** software and app are the main tools for configuring and analyzing **RHT** data. They allow you to explore all the features of the equipment, communicating through the **TxConfig-USB** Configuration Interface.

This manual describes the features related to **RHT**. For more specific instructions on how to operate **SigNow** tools, check the specific operations manual. The software and its respective manual can be downloaded for free in the Download Area of our website www.novusautomation.com.

To install it, simply run the **SigNowSetup.exe** file and follow the instructions in the installer.

SigNow app can be downloaded for free from *Google Play Store*.

5.1 SIGNOW SOFTWARE

When running **SigNow**, the home screen will be presented:



Figure 11

To communicate with the software, **RHT** must be connected to the computer through a **TxConfig-USB** Configuration Interface and have the USB drivers previously installed (see [CONFIGURATION](#)).

Next, click on **Configuration** (see [CONFIGURATION SECTION](#)) or **Diagnostic** (see [DIAGNOSTIC SECTION](#)).

5.1.1 CONFIGURATION SECTION

The **Configuration** button, located on **SigNow** home screen, reads the current configuration of the device. Selecting this option will display all the features available for configuration, as shown in the sections below.

The configuration screen is divided into 4 sections: **Temperature**, **Humidity**, **Output 1**, and **Output 2**. The bottom part of the screen displays information about the equipment, such as name, serial number, and firmware version.

5.1.1.1 TEMPERATURE CONFIGURATION

When connecting to the equipment, the following screen will be displayed:

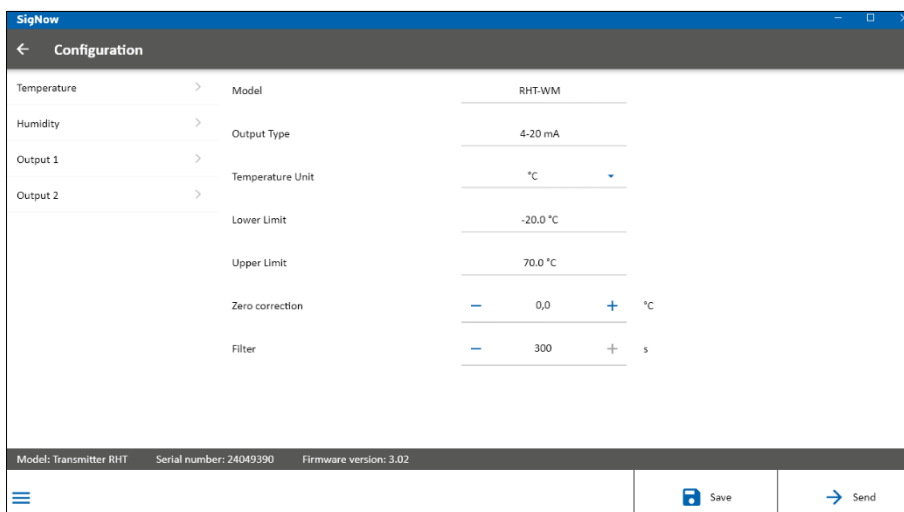


Figure 12

In the **Temperature** screen (see above), you can see information and set values for the following parameters:

- **Model:** Shows the **RHT** model.
- **Output type:** Shows the output type of equipment.
- **Temperature Unit:** Allows you to set the temperature unit to be used.
- **Lower Limit:** Displays the minimum temperature for the output type.
- **Upper Limit:** Displays the maximum temperature for the output type.
- **Zero Correction:** Allows you to adjust the Offset of the reading of the measured quantity.
- **Filter:** Allows you to set the filter value to be applied.

5.1.1.2 HUMIDITY CONFIGURATION

Parameter	Value	Unit
Model	RHT-WM	
Output Type	4-20 mA	
Lower Limit	0.0	%rh
Upper Limit	100.0	%rh
Zero correction	0.0	%rh
Filter	0	s

Model: Transmitter RHT Serial number: 24049390 Firmware version: 3.02

Save Send

Figure 13

In the **Humidity** screen (see above), you can see information and set values for the following parameters:

- **Model:** Shows the **RHT** model.
- **Output type:** Shows the output type of equipment.
- **Lower limit:** Displays the minimum relative humidity percentage for the output type.
- **Upper limit:** Displays the maximum relative humidity percentage for the output type.
- **Zero Correction:** Allows you to adjust the Offset of the reading of the measured quantity.
- **Filter:** Allows you to set the filter value to be applied.

5.1.1.3 OUTPUT 1 CONFIGURATION

Parameter	Value	Unit
Model	RHT-WM	
Physical Property	Temperature	
Reverse output polarity	No	
Lower Limit	0.0	°C
Upper Limit	70.0	°C
Error action on the analog output	Minimum/Maximum	

Model: Transmitter RHT Serial number: 24049390 Firmware version: 3.02

Save Send

Figure 14

In the **Output 1** (see above), you can see information and set values for the following parameters:

- **Model:** Shows the **RHT** model.
- **Physical property:** Allows you to set the physical property to be measured: **Temperature**, **Humidity**, or **Dew Point**. By clicking the **Off** option, it is possible to disable this output.
- **Reverse output polarity:** Allows you to reverse the polarity of the output.

- **Lower limit:** Allows you to set the desired minimum temperature for the output type.
- **Upper limit:** Allows you to set the desired maximum temperature for the output type.



Although this parameter accepts values higher than 70 °C, the equipment can measure up to 70 °C.

- **Analog output error action:** If an error is detected in the analog output, it allows you to set the error action to be taken, either for maximum error or minimum error.

5.1.1.4 OUTPUT 2 CONFIGURATION

Figure 15

In the **Output 2** (see above), you can see information and set values for the following parameters:

- **Model:** Shows the **RHT** model.
- **Physical property:** Allows you to set the physical property to be measured: **Temperature**, **Humidity**, or **Dew Point**. By clicking the **Off** option, it is possible to disable this output.
- **Reverse output polarity:** Allows you to reverse the polarity of the output.
- **Lower limit:** Allows you to set the desired minimum relative humidity percentage for the configured output type.
- **Upper limit:** Allows you to set the desired maximum relative humidity percentage for the configured output type.



Although this parameter accepts values higher than 70 °C, the equipment can measure up to 70 °C.

- **Analog output error action:** If an error is detected in the analog output, it allows you to set the error action to be taken, either for maximum error or minimum error.

5.1.2 DIAGNOSTIC SECTION

The **Diagnostic** button, located on **SigNow** home screen, allows you to obtain information about the operation of the equipment, as well as to force values according to the type of output. This example shows the current output, so it is possible to force values within the 4-20 mA range, maximum (21.5 mA) or minimum (3.6 mA) error values.

To use this feature, you need to use an external source. In addition, you must use a **TxConfig-USB** Configuration Interface to connect your **RHT** to the USB port of the computer.

Below is an example of the electrical connections:

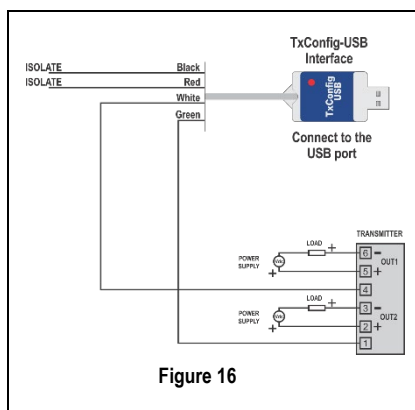


Figure 16

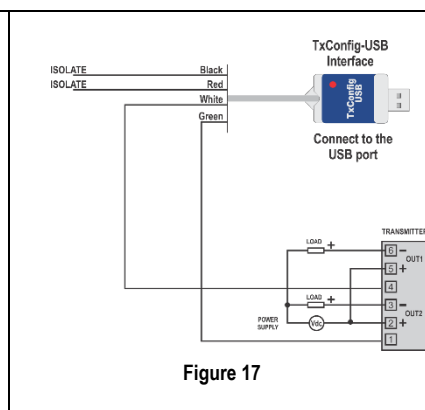


Figure 17


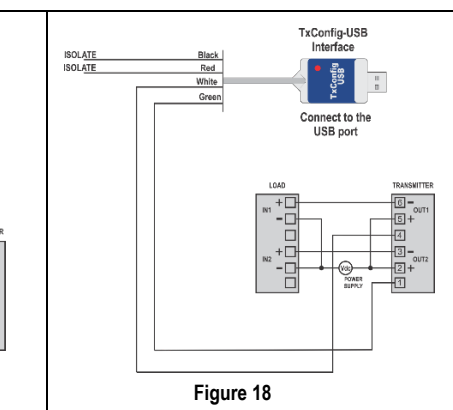




Figure 18

Once you have made the necessary connections, simply access the **Diagnostic** section of the software. By selecting the **Output** option of the **Forcing** tab, it is possible to force values for outputs 1 and 2. In these examples, values are being measured using a multimeter:

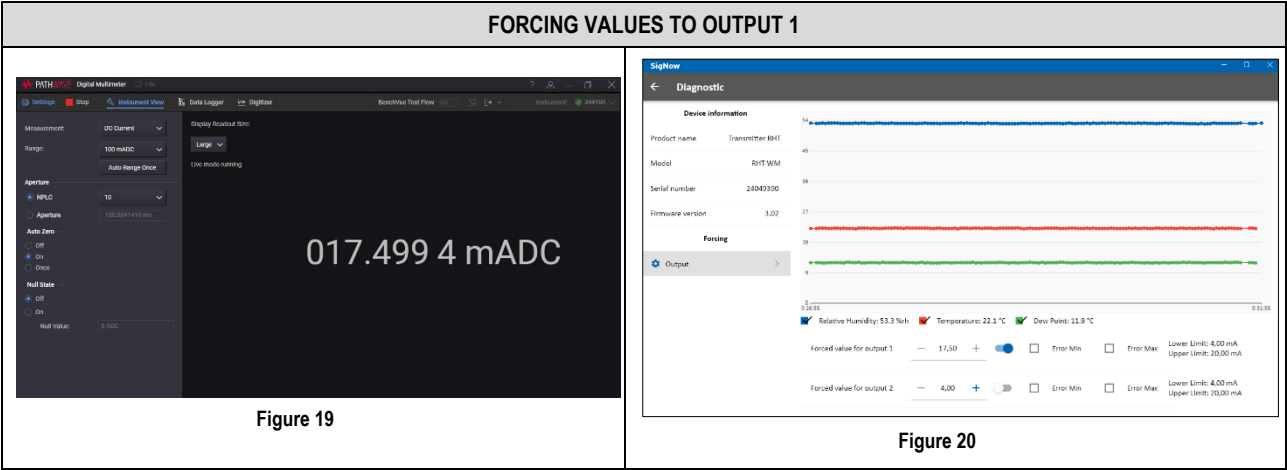

At the bottom of the graph, there are checkboxes that allow you to enable or disable the display of information about the temperature, relative humidity, and Dew Point values: ☒ Relative Humidity: 60.7 %rh, ☒ Temperature: 22.9 °C and ☒ Dew Point: 14.6 °C.

The examples below show situations where you are forcing a minimum error value and then a maximum error value:

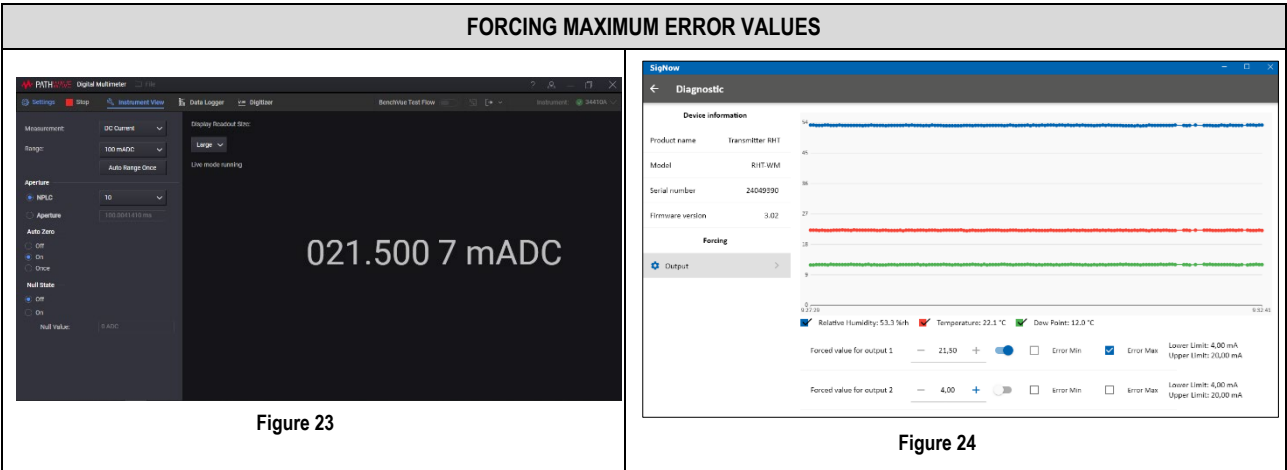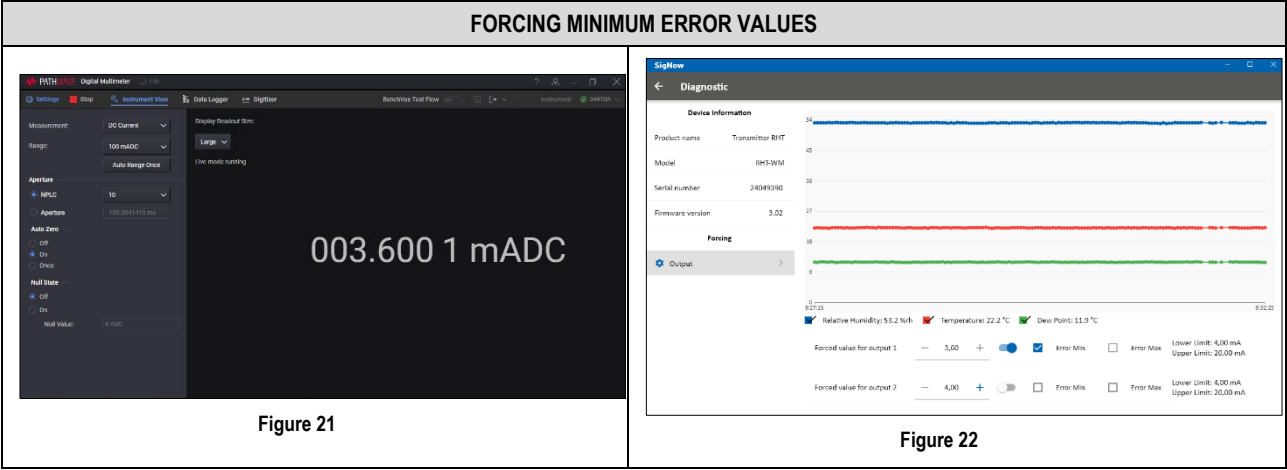

5.2 SIGNOW APP

When using an OTG cable (not supplied) and the **TxConfig-USB** Configuration Interface to connect the equipment to your smartphone and run **SigNow** app (see [CONFIGURATION](#)), you must first enable the use of **TxConfig-USB**. The interface will act as an intermediary for the connection:

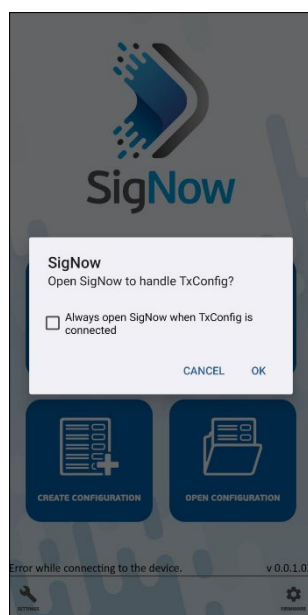


Figure 25

After that, the app will recognize the equipment and show the main screen:

Just click on the **Configuration** button to display the main screen of the **RHT** Configuration section:

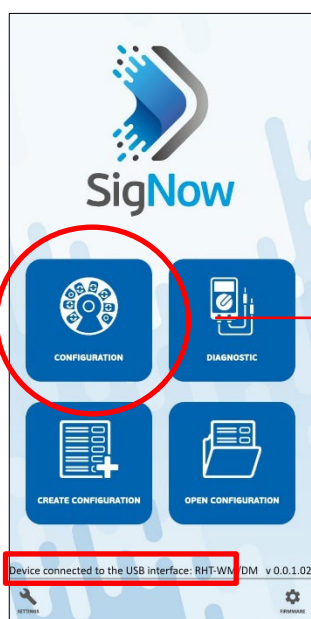


Figure 26



Figure 27

This is the first screen of the section and displays information about the equipment.

Clicking on the **Config** button allows you to display the configuration sections.

This screen shows information about the equipment, such as name, serial number, and firmware version.

When you open the **Config** section, you can configure the parameters displayed in the [CONFIGURATION SECTION](#). By clicking on the **Diagnostic** button on the home screen, you can perform diagnostics and force values for the outputs (see [DIAGNOSTIC SECTION](#)).

To make the integration process more user-friendly, **SigNow** app and **SigNow** software have the same screens, and the parameters of the respective screens are always the same.

In **SigNow** manual, available on **NOVUS** website, it is possible to obtain more information about some features, such as the firmware update process and the process of creating and saving a configuration.

FEATURES	RHT-DM / RHT-WM
Humidity measurement	Total accuracy (see Note 2): See Figure 28 . Measurement range : Configurable between 0 and 100 % RH or -100 and 103 °C (-148 and 217.4 °F) at Dew Point. Response Time (1/e (63 %)) : 8 seconds @ 25 °C (with air moving at 1 m/s).
Sensor temperature measurement	Total accuracy (see Note 2): See Figure 28 . Measurement range : • DM Model: Configurable between -40 and 120 °C (-40 and 248 °F). • WM Model: Configurable between -20 and 70 °C (-4 and 158 °F). Response Time (1/e (63 %)) : Up to 30 s (with air moving at 1 m/s).
Transmitter operating temperature	Operating temperature: -20 to 70 °C (-4 to 158 °F), 0 to 95 % RH. Storage temperature: -20 to 80 °C (-4 to 176 °F).
Power supply	12 Vdc to 30 Vdc.
Range of sensor readings	< 1.5 seconds.
Outputs	4-20 mA or 20-4 mA current, 2-wire type – loop powered.
Load on the outputs (RL)	$RL \text{ (max. in Ohms)} = (Vdc - 12) / 0.02$, where: Vdc = Supply Voltage in Volts.
OUT1 and OUT2: Output resolution	0.0008 mA (4-20 mA).
Isolation between outputs	Isolated 4-20 mA outputs.
Protection index	Electronic module housing : IP65. Sensor's protective tip : • Polyamide tip: IP40 • High Density Polyethylene (PE) tip: IP40 • Sintered Bronze tip: IP40
Cables	PG7 cable gland.
Operational limits	Sensor and Probe (RHT-DM) : See Figure 28 .
Configurator software	• SigNow software, compatible with Windows 10 or higher. • SigNow app, compatible with Android and iOS smartphones.
S35 RHT sensor for replacement	Order code: 803900040.
Certifications	CE.
Internal protection against reversal polarity of voltage supply.	

Table 1

IMPORTANT

The sensor used in this equipment may be damaged or lose calibration if it is exposed to atmospheres contaminated with chemical agents. Hydrochloric Acid, Nitric Acid, Sulfuric Acid, and Ammonia in high concentrations can damage the sensor. Acetone, Ethanol and Propylene Glycol can cause reversible measurement error.

6.1 ACCURACY OF MEASUREMENTS AND OPERATING LIMITS OF SENSORS

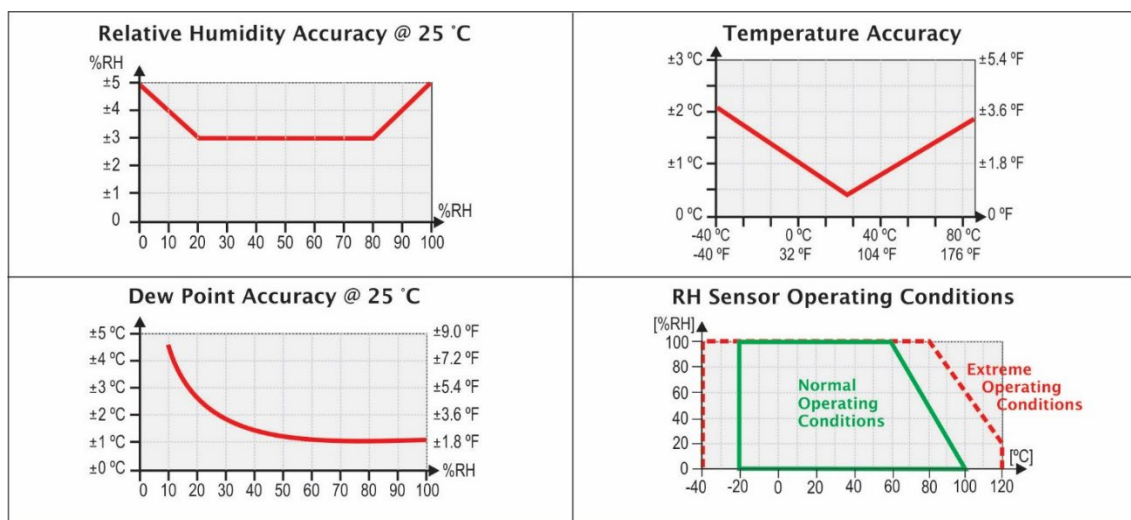


Figure 28

Note 2: When performing a transmitter calibration through a Metrology Lab, it is necessary to consider that the calibration uncertainty must be added to the product accuracy.

If the humidity sensor is exposed to contaminant vapors or to extreme humidity and temperature conditions for prolonged periods, its calibration may drift. To attempt to restore accuracy, it is recommended to perform the sensor baking and rehydration procedures (see [PRECAUTIONS WHEN HANDLING SENSORS](#)).

6.2 FACTORY SETTINGS

The table below shows the factory configuration of the equipment:

PARAMETER	FACTORY VALUE	
Output 1 (OUT1)	RHT DM	Temperature: 0-100 °C
	RHT WM	Temperature: 0-70 °C
Output 2 (OUT2)	RHT DM	Humidity: 0-100 %RH
	RHT WM	Humidity: 0-100 %RH
Zero correction	Humidity	0
	Temperature	0
Filter	Humidity	0
	Temperature	0
Error action on the analog output	Output 1	Maximum (21.5 mA)
	Output 2	Maximum (21.5 mA)
Reverse output polarity	Output 1	No
	Output 2	No
Temperature unit	°C	

Table 2

6.3 CERTIFICATIONS

CE Mark

This is a Class A product. In a domestic environment, this product may cause radio interference in which case the user may be required to take adequate measures.

7 WARRANTY

Warranty conditions are available on our website www.novusautomation.com/warranty.